

CONTROL-adapter GAC 600


ASENNUSOHJE, INSTALLATION INSTRUCTION, MONTAGEANWEISUNG, INSTALLATIONSANVISNING

GAC 600 Valintavirrannotolaite sähköiset arvot	GAC 600 Adapter electrical properties	GAC 600 Adapter elektrische Eigenschaften	GAC 600 Adapter elektriska egenskaper	EUROPE FI, CE	USA/CANADA
				Un 250V, In 10A +FELV max. 1A 50VAC (vähintään peruseristetty esim. DALI signal)	Un 250V, In 10A +FELV max. 1A 50VAC (cable with basic isolation e.g. DALI signal)
Suojausluokka	Class	Schutzklasse	Skyddsklass	I	I
Vetolujuus	Pull strength	Zugfestigkeit	Draghållfasthet	100 N (20 lbs)	100 N (20 lbs)
Taivutusmomentti	Bending moment	Biegemoment	Böjmoment	max. 2,5 Nm	max. 2,5 Nm
Käytetään kohdevalaisimien kiinnitykseen 3-piiriskoihin	For connection of spotlights to 3-circuit tracks.	Für Aufspannen von Strahlern in 3-Phasenschienen	För anslutning av spotlights i 3-fasskenor	GLOBAL trac pulse dali XTSC(F) 6	GLOBAL trac pulse dali XTSC(F) 6

WARNING - NORDIC ALUMINIUM LIGHTING TRACK SYSTEMS

It is forbidden to use any kind of solvent, glue, grease, oil or cleaner etc. in contact with Nordic Aluminium adapters or other lighting track components. These foreign materials can cause cracking and/or damage to the components for which Nordic Aluminium will not be liable for.


Liitäntäkaapelin vaipan poisto.
Avmantling av kabeln.
Entschälung des Kabels.
Stripping of the cable.

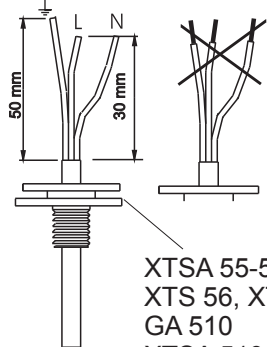


XTSA 55-57, 360
XTS 56, XTS 58
GA 510
XTSA 510, 513

Monilankainen liitäntäjohto 0,5...1,0mm².
Mångtrådig kopplingsstråd 0,5...1,0mm².
Mehrdrahtleitung 0,5...1,0mm².
Cord stranded wire 0,5...1,0mm².


Johtimet painetaan liittimiin johtimien.
Ledarna trycks in i kontakterna.
Die Leitungen werden in die Anschlussklemme eingepresst.
The cables are pressed into the connecting terminal.

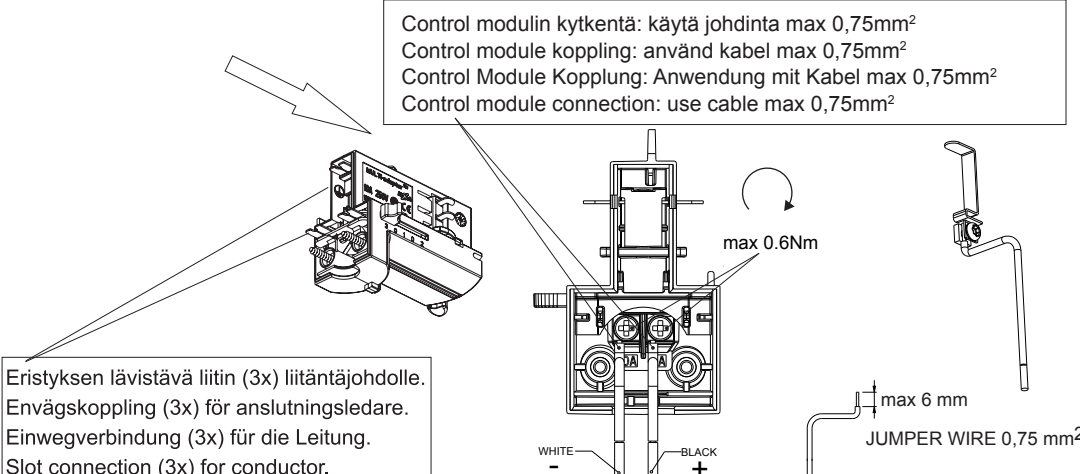


Eristyksen lävistävä liitin (3x) liitäntäjohdolle.
Envägskoppling (3x) för anslutningsledare.
Einwegverbindung (3x) für die Leitung.
Slot connection (3x) for conductor.

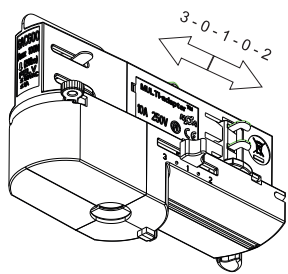

Vaiheet (1, 2 tai 3) voidaan valita ennen virran-
ottolaitteen kiinnitystä kiskoon tai kiinnitettynä.
Fasen (1,2 eller 3) kan väljas före koppling i
skena eller därefter
Wahl der Phase (1,2 oder 3) vor der
Aufspannen in der Schiene oder nacher
Choose the phase (1,2 or 3) before fastening
into the track or afterwards.

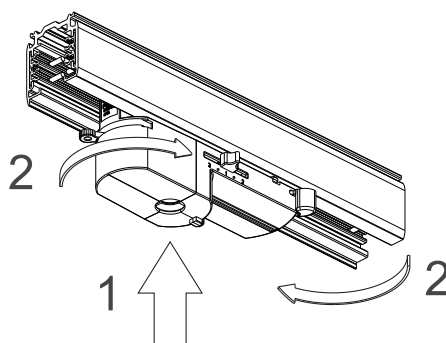

Virrannotolaitteen kiinnitys kiskoon.
Koppling av adaptern.
Aufspannen des Adapters.
Fastening of the adapter

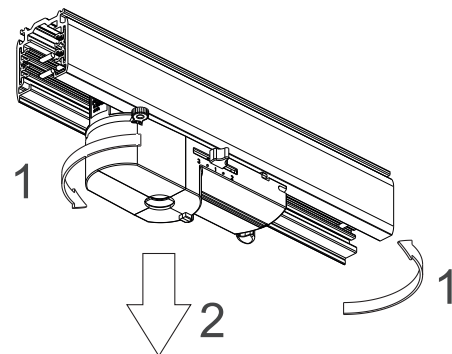

Virrannotolaitteen irroitus kiskosta.
Lösgrände av adaptern.
Auslösung des Adapters.
Removing the adapter.

Product and operational safety

It is allowed only to use the parts presented and they must be installed according to these installation instructions. NORDIC ALUMINIUM Plc as manufacturer of the product is not responsible for the safety and function of the system if parts not belonging to this are used or if any deviations from the installation instructions are made. It is then the user's responsibility to ensure The electrical, mechanical and thermal compatibility between the product and the fixtures attached to it.

Manufacturer
Tillverkare
Hersteller
Valmistaja

NORDIC ALUMINIUM

Europe
P.O. Box 117, FI-02401 Kirkkonummi, Finland
Tel. +358 20 7660 200, fax +358 20 7660 485
www.nordicaluminium.fi
USA

Nordic Aluminium, Inc. 1075 Old Norcross Road,
Suite A, Lawrenceville, GA 30045, USA
Ph: 678-407-7876, Fax: 678-407-7875